


Connector Face

Click to toggle focus

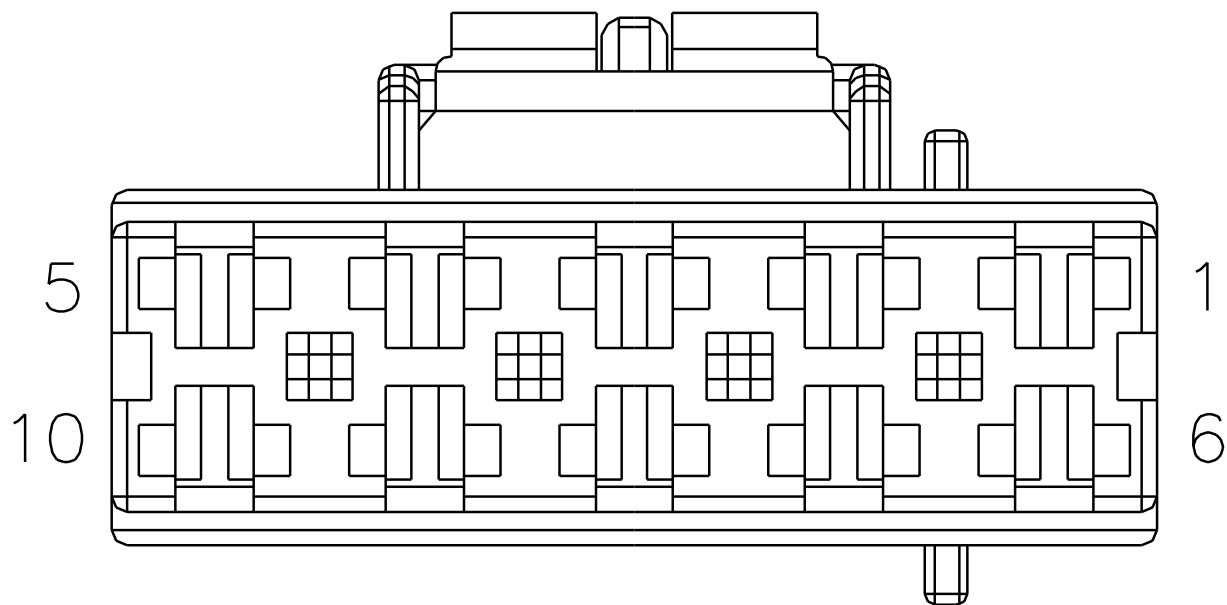

PLATIN GREY

Housing

Serviceable

Engineering Part Number

DHCT-14489-DYB

Service Part Number

LR159970

Colour

GREY

Cavities

10

Harness

ENGINE COMPARTMENT LH HARNESS

Description


Junction box-engine

Location

Rear RH side of engine compartment

Qualifier

LHD condition illustrated

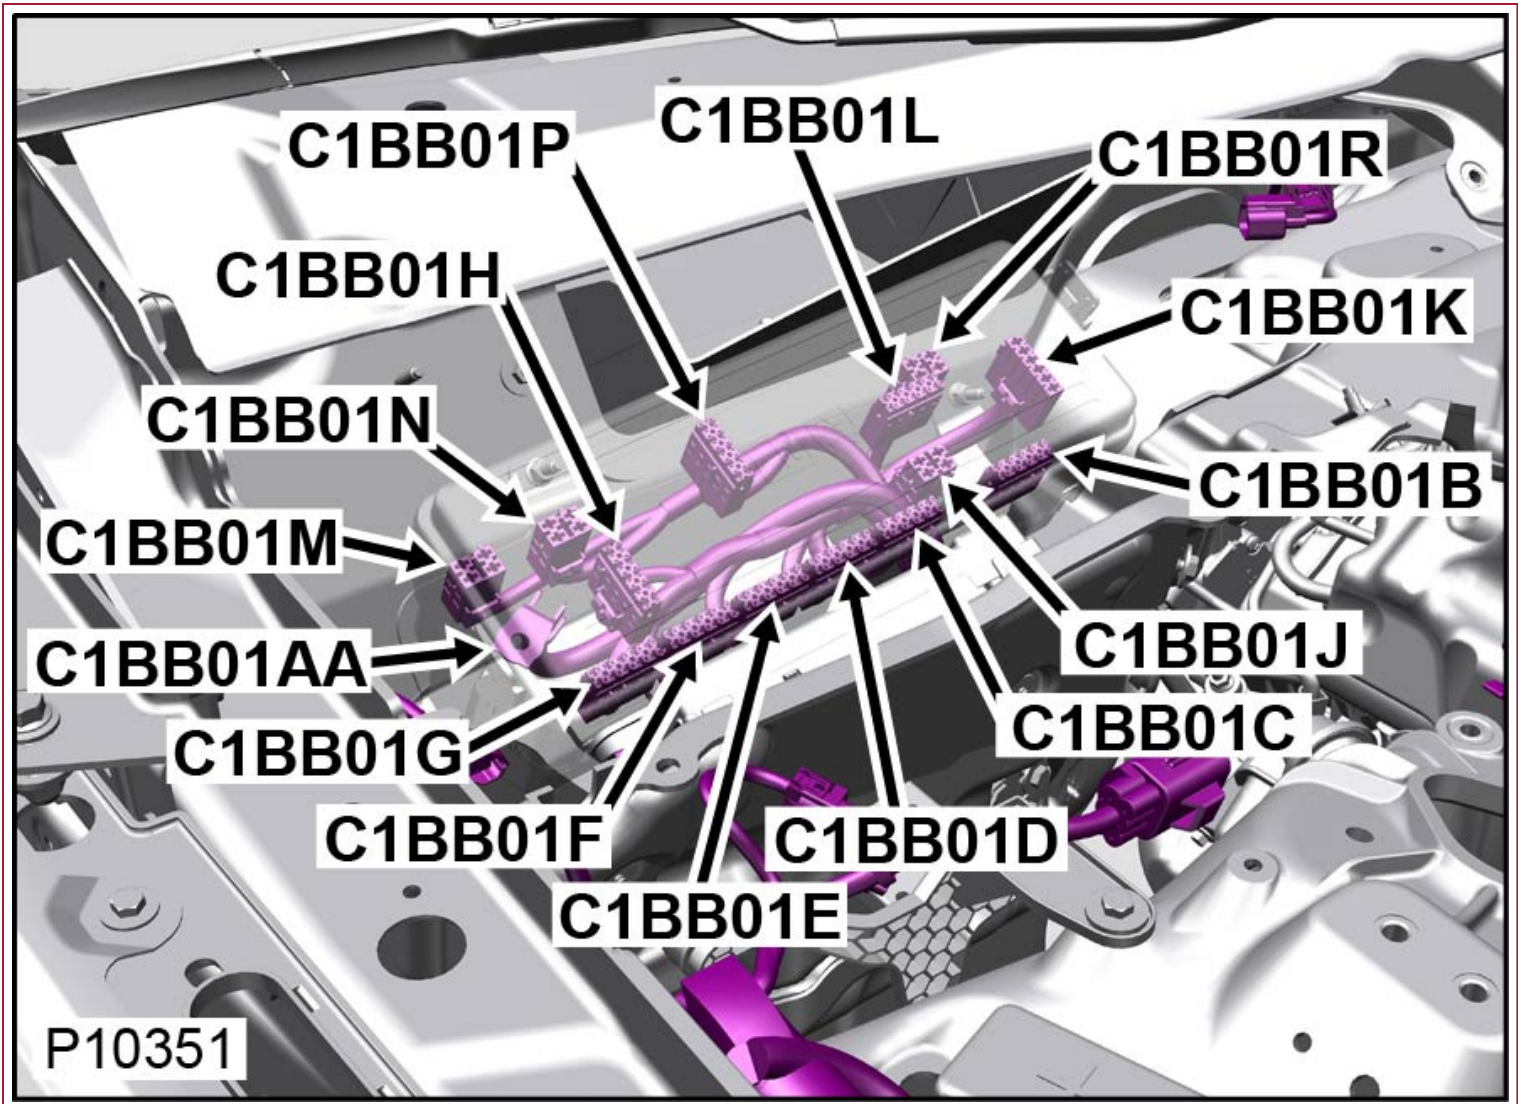

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Wire Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	BK	ALL	SP11124	418-580	-	418-116A	418-672	418-104	418-113	418-108
2	0.5	VT-OG	ALL	C2BP01H	418-579	-	418-116A	418-672	418-104	418-112	418-107
3	0.5	BN-YE	HYBRID	S1DC86A	418-579	-	418-116A	418-672	418-104	418-112	418-107
5	0.35	WH-GN	ALL	C12-A1	418-585	-	418-116A	418-672	418-104	418-112	418-107
6	0.5	RD	HYBRID	C1CA01A	418-579	-	418-116A	418-672	418-104	418-112	418-107
7	0.5	VT-GN	ALL	C2BP01G	418-579	-	418-116A	418-672	418-104	418-112	418-107
9	0.5	WH-BN	CFKAE	C2BP01H	418-579	-	418-116A	418-672	418-104	418-112	418-107
10	0.5	RD	ALL	C2BP01H	418-579	-	418-116A	418-672	418-104	418-112	418-107