

2016.0 RANGE ROVER (LG), 501-26

BODY REPAIRS - VEHICLE SPECIFIC INFORMATION AND TOLERANCE CHECKS

TAILGATE ALIGNMENT (G2032472)


GENERAL PROCEDURES

CHECK

1. Remove the spoiler.

Refer to: [Rear Spoiler](#) (501-08 Exterior Trim and Ornamentation, Removal and Installation).

- 2.

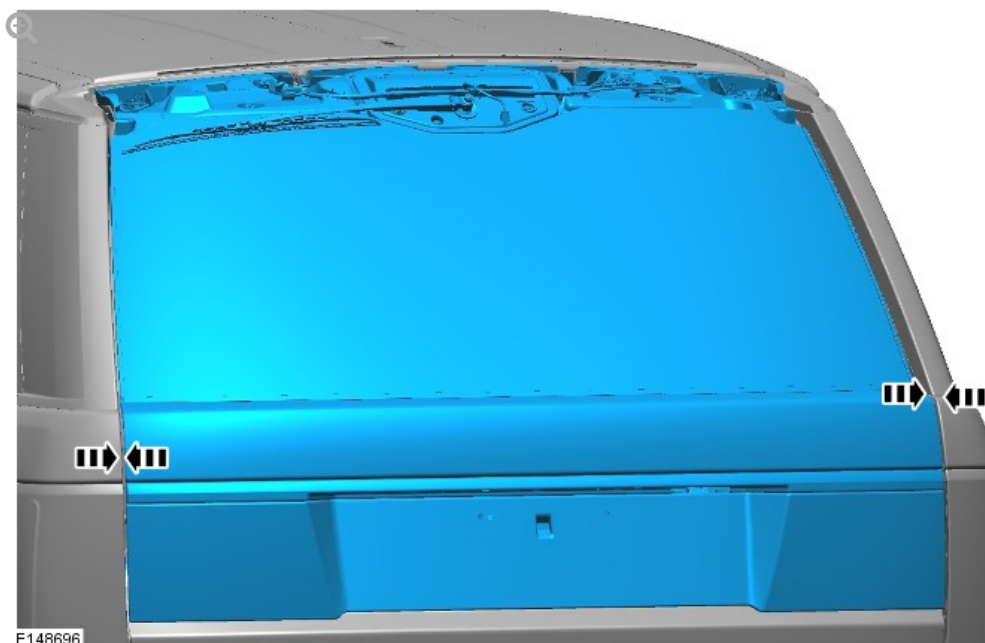

With the liftgate closed, check the alignment of the liftgate to the roof panel and body side panel. The liftgate should be central in its aperture.

Refer to: [Body and Frame](#) (501-26 Body Repairs - Vehicle Specific Information and Tolerance Checks, Description and Operation).

ADJUSTMENT

3.

NOTES:

- Make sure that the tailgate is flush with the fender at point 1.
- Make sure that the tailgate is recessed by 1.5 mm in relation to the fender, at point 2.



Loosen, but do not remove the liftgate hinge bolts.

Refer to: [Body and Frame](#) (501-26 Body Repairs - Vehicle Specific Information and Tolerance Checks, Description and Operation).

4. Tighten the liftgate hinge bolts.

Torque: 24 Nm

5. Install the spoiler.

Refer to: [Rear Spoiler](#) (501-08 Exterior Trim and Ornamentation,

Removal and Installation).